



Lippert Components, Inc. Informational Publication


LIP Sheet - 0003


CORRECTIVE ACTION FOR SQUEAKING 2 X 3 GEAR PACKS

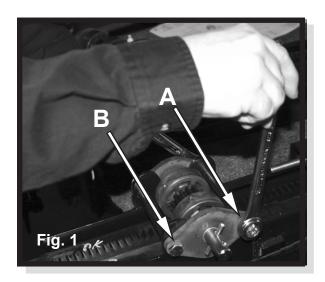

- <u>Step 1</u> Loosen both gear pack bolts, (Fig. 1, A and B) until tension is off of the gear pack.
- <u>Step 2</u> Using a manual pump oil can, pump 2-3 squirts of synthetic motor oil* onto gear pack drive shaft in lubrication points C (Fig. 2), D (Fig. 3) E, F, G and H (Fig. 4).
- **NOTE:** Do not lubricate rack or pinion gear teeth. Lubricate drive shaft only.
- <u>Step 3</u> Extend and retract slideout arms several times to work lubricant through gear pack.

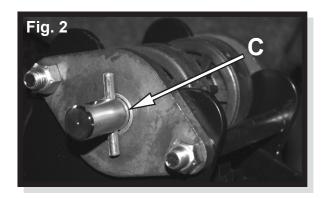

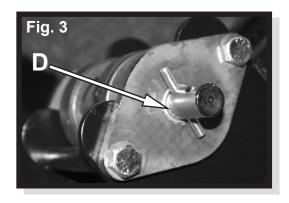

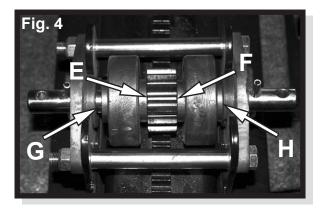

LCI recommends Mobil One Fully Synthetic 10W-30 Motor Oil to lubricate gear pack.